

CANON NON-OIL T-SHIRT TRANSFER PAPER FOR FABRIC INSTRUCTIONS FOR USE

DESCRIPTION:

CANON NON- OIL T- SHIRT TRANSFER

PAPER SIZES AND ORDER INFORMATION

17" X 11" 0819V805 100 SHEETS

RECOMMENDED FOR USE WITH -

COLOR IMAGE RUNNER IR C3200/C3220/C2620, IR C5180/C4580/ C4080

REASON FOR USAGE -

TRANSFER OF COLOR AND B/W IMAGES TO WHITE / LIGHT COLORED COTTON FABRICS


SUGGESTIONS DURING USAGE -

- CANON HAS TESTED THIS MEDIA IN LIMITED QUANTITIES, AND HAS FOUND THE RESULTS IN NORMAL OFFICE ENVIRONMENTS (25% - 70% RELATIVE HUMIDITY) TO BE RELIABLE.
- MINIMIZE THE HANDLING OF THE IMAGE AREA TO AVOID SCRATCHES AND SMUDGES.

DIRECTIONS:

COPYING AND PRINTING

- BY PASS TRAY- FAN THE T-SHIRT TRANSFER PAPER AND PLACE IN THE BYPASS TRAY WITH THE CANON LOGO SIDE FACING DOWN. SELECT 11X17 > NEXT > HEAVY 1 > OK > DONE
- PAPER DELIVERY - ENSURE PAPER DELIVERY IS SET FOR THE COPIER'S TOP DELIVERY TRAY, (NO FINISHER TRAYS IF EQUIPPED WITH A FINISHER). SELECT ADDITIONAL FUNCTIONS > COMMON SETTINGS > TRAY DESIGNATION > SELECT THE COPIER TOP TRAY AND NOT ANY FINISHER TRAYS (IF EQUIPPED WITH A FINISHER). ALSO SELECT THE COPIER TOP TRAY DEPENDING ON WHETHER THE T-SHIRT TRANSFERS WILL BE MADE FROM THE COPY GLASS OR FROM THE PRINT DRIVER

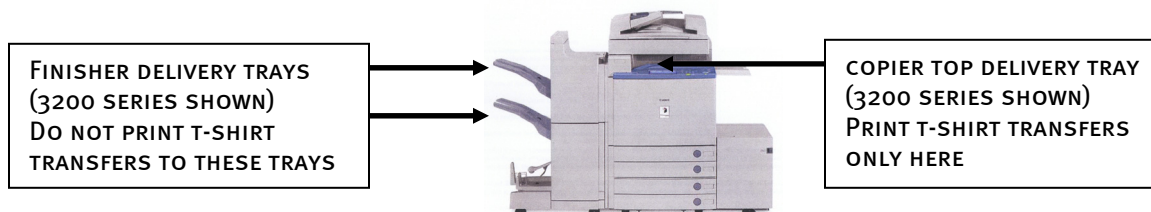

- TURN ON THE MIRROR IMAGE FUNCTION WHEN COPYING FROM THE COPY GLASS/SCANNER OR FROM THE PRINT DRIVER WHEN PRINTING.
- TRIM AWAY THE UNPRINTED PAPER AROUND THE IMAGE AREA AFTER COPYING TO OBTAIN BEST RESULTS.

TRANSFER

- PREHEAT THE HEAT PRESS. (TEMPERATURES MAY VARY DEPENDING ON EQUIPMENT)
- FOR COTTON AND COTTON BLENDS: SET HEAT PRESS AT 375°-385° F (180°-190° C).
- SET THE PRESSURE TO HIGH (60 – 80 PSI)
- FOR T- SHIRT APPLICATIONS, PRESS THE T-SHIRT FOR 5 SECONDS TO ELIMINATE CREASES AND WRINKLES
- PLACE TRANSFER WITH IMAGED SIDE DOWN ONTO THE T-SHIRT. PRESS FOR APPROXIMATELY 20 SECONDS (TIME MAY VARY DEPENDING UPON EQUIPMENT AND SUBSTRATE TO BE TRANSFERRED)
- IMMEDIATELY PEEL THE RELEASE LINER AFTER TRANSFERRING

WASHING AND DRYING

- USE COLD OR WARM WATER
- USE REGULAR DETERGENT ONLY (NO BLEACH OR BLEACH ADDITIVES)
- TURN T-SHIRT INSIDE OUT BEFORE WASHING
- HANG DRY OR USE WARM AIR DRY CYCLE

TIP: - TRANSFER IMAGE COLOR WILL DEGRADE AFTER WASHING BUT CAN BE ENHANCED BY DIRECTLY IRONING IMAGE. SET IRON TO 375°-385° F (180°-190° C).